

REPLACEMENT THERMOSTAT COVER


THIS EFFECTS EARLY SHIRE ENGINES WITH BASE 3TNE BLOCKS

The original thermostat housing of RDG2579 is now no longer available and will need to be repaired/replaced by the below.

ORIGINAL COVER REPLACEMENT NLA: RDG2579



NEW STYLE COVER: RDG504A15

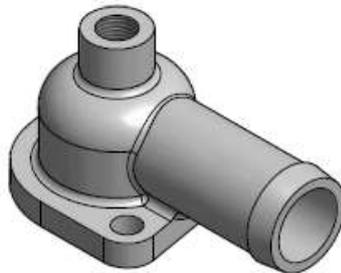

1. Repair the old one.
2. Get a new one made using the old one as a pattern
3. Due to the reorientation of the mounting holes you will need to fit the new housing (as above) and change/re-route the hoses on the boat to match the outlet position. Plus you will need the normal Yanmar gasket (129795-49551) and a ¼" BSP M/F elbow in the top to a ¼" BSP to 5/16" hose tail to fit the leak off hose to.